

WAAS CH <b>69513</b> <b>W31A</b>	APP CRS <b>312°</b>	Rwy Idg <b>4825</b> TDZE <b>82</b> Apt Elev <b>85</b>
--	------------------------	---

RNAV (GPS) Z RWY 31

SALINAS MUNI (SNS)

▼

Baro-VNAV NA when using Monterey Rgnl altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 50°C (122°F).

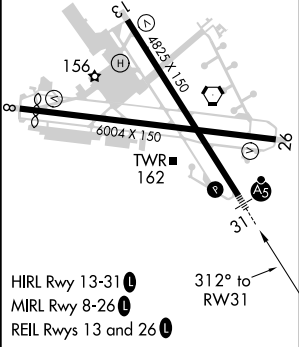
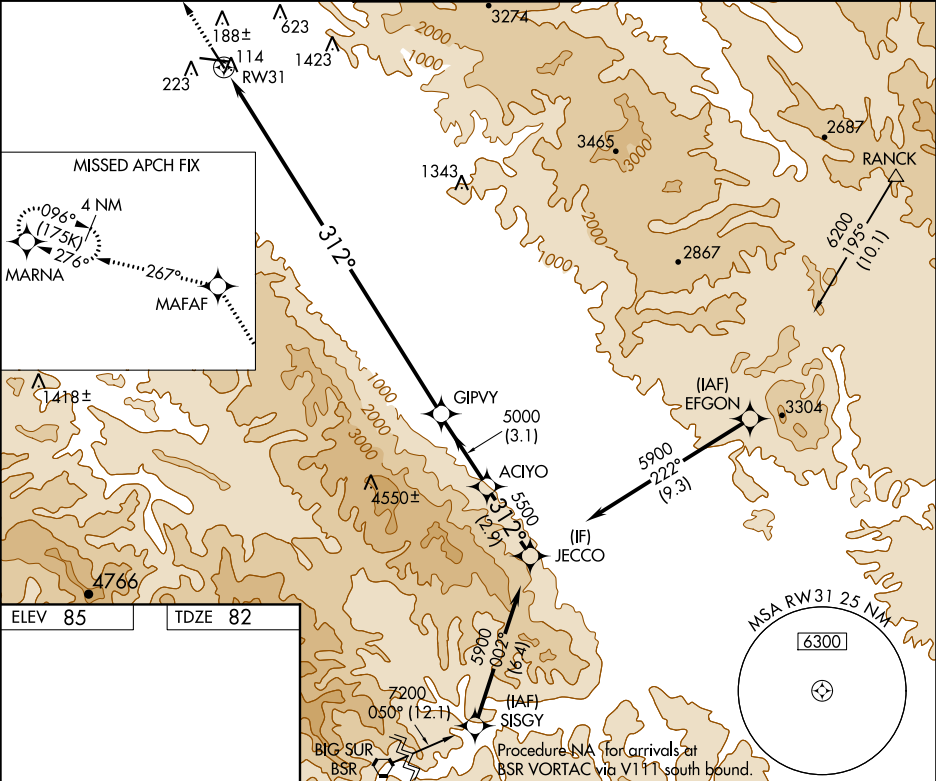
▲





DME/DME RNP-0.3 NA. When local altimeter setting not received, use Monterey Rgnl altimeter setting and increase all DA 53 feet and LNAV/VNAV all Cts visibility to RVR 5000.

MALSR

MISSED APPROACH: Climb to 3000 direct MAFAF and left turn via track 267° to MARNA and hold.

ATIS <b>124.85</b>	NORCAL APP CON <b>133.0 251.15</b>	SALINAS TOWER ★ <b>119.525 (CTAF) 239.3</b>	GND CON <b>121.7</b>	UNICOM <b>122.95</b>
-----------------------	---------------------------------------	--	-------------------------	-------------------------



3000	MAFAF	 tr 267°	MARNA	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00°/TCH 61).					
					JECCO	ACIYO	GIPVY	5900	Procedure Turn NA  GP 3.00° TCH 50
							5000		
							5000		