


APP CRS	Rwy Idg	10113
101°	TDZE	809
	Apt Elev	815

RNAV (RNP) Z RWY 10R

JOHN GLENN COLUMBUS INTL (CMH)

RNP AR APCH.				<div>MALSR</div> <div></div>	MISSED APPROACH: Climb to 3000 on track 101° to CORED and hold.	
<div>T</div> <div>Simultaneous approach authorized. For uncompensated Baro-VNAV systems, procedure NA below -18°C or above 54°C. For inoperative ALS, increase RNP 0.17 all Cats visibility to RVR 5900, increase RNP 0.30 all Cats visibility to 1½ SM.</div>						
D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC	

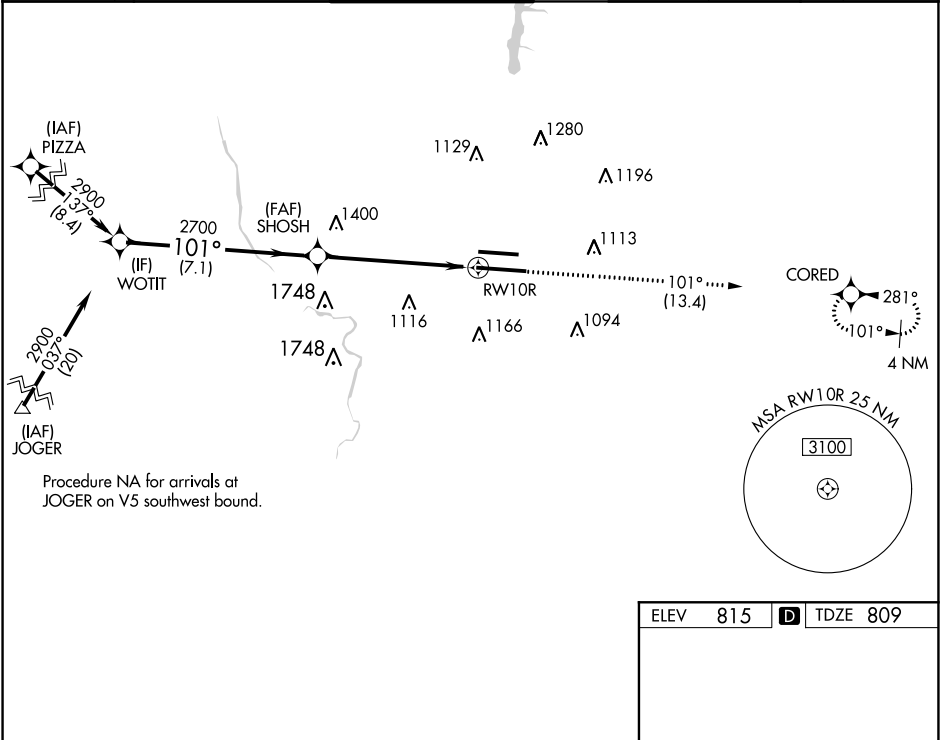

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00°/ TCH 70').

CATEGORY	A	B	C	D
RNP 0.17 DA		1171/35	362 (400-½)	
RNP 0.30 DA		1288/55	479 (500-1)	

AUTHORIZATION REQUIRED

TDZ/CL Rwy 10R-28L
HIRL Rwy 10R-28L and 10L-28R