
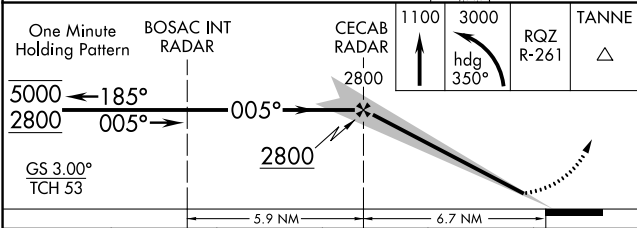


LOC I-ELL 108.5	APP CRS 005°	Rwy Idg 12600 TDZE 615 Apt Elev 629
---------------------------	------------------------	--

ILS or LOC RWY 36L
HUNTSVILLE INTL-CARL T JONES FIELD (HSV)

RADAR required for procedure entry.			MALSR	MISSED APPROACH: Climb to 1100 then climbing left turn to 3000 on heading 350° to RQZ R-261 to TANNE INT/RQZ 17.6 DME and hold.
Simultaneous approach authorized. For inop ALS, increase S-ILS 36L Cat E visibility to RVR 4000, S-LOC 36L Cat C/D/E visibility to 1¾ SM. Circling NA for Cat C/D/E east of Rwy 18L-36R.				

ATIS 121.25	HUNTSVILLE APP CON ★ 125.6 354.1	HUNTSVILLE TOWER ★ 127.6 (CTAF) 350.35	GND CON 121.9 269.525	CLNC DEL 120.35	UNICOM 122.95
-----------------------	--	--	---------------------------------	---------------------------	-------------------------

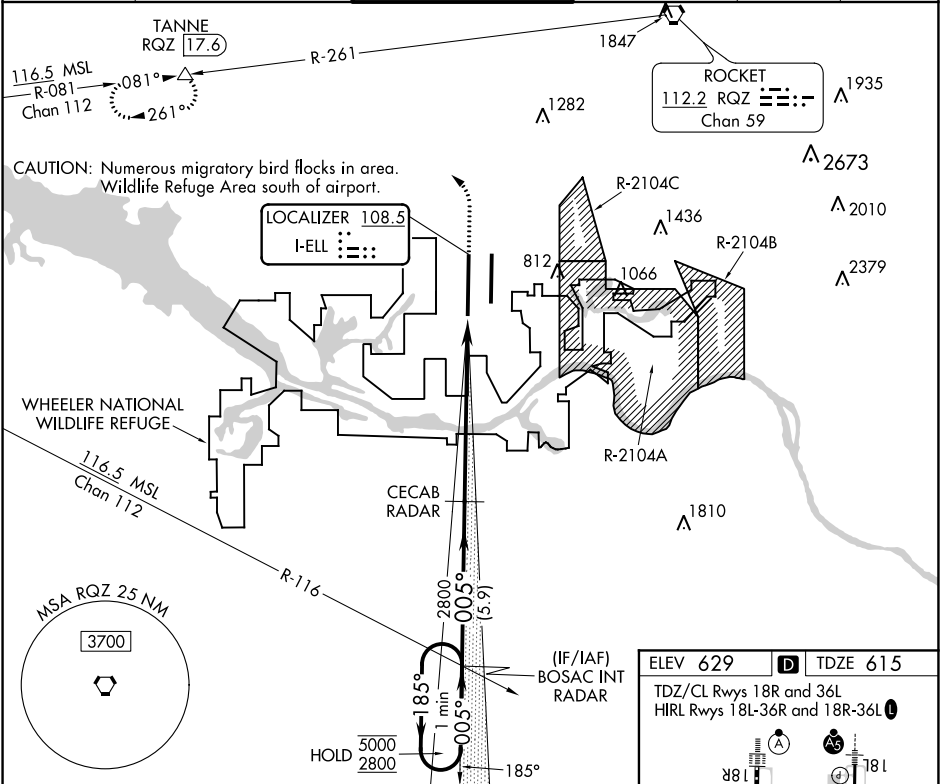

CATEGORY	A	B	C	D	E
S-ILS 36L	815/18 200 (200-½)				
S-LOC 36L	1240/24 625 (700-½)	1240-1¾ 625 (700-1¾)			
CIRCLING	1240-1 611 (700-1)	1240-1¾ 611 (700-1¾)	1240-2 611 (700-2)	1260-2¼ 631 (700-2¼)	

