

WAAS CH 90505 W04A	APP CRS 037°	Rwy Idg 5500 TDZE 904 Apt Elev 904
--	------------------------	---

RNAV (GPS) RWY 4

BOLTON FIELD (TZR)

RNP APCH.

T


For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to 1 ¼ SM and LNAV Cats C/D visibility to 1 ¾ SM.

MALSR

MISSED APPROACH:

Climb to 3000 direct OYILU and left turn on track 294° to MECAN and hold.

AWOS-3 135.925	COLUMBUS APP CON 134.0 279.6	BOLTON TOWER ★ 128.1 (CTAF) 0	GND CON 121.8
--------------------------	--	---	-------------------------

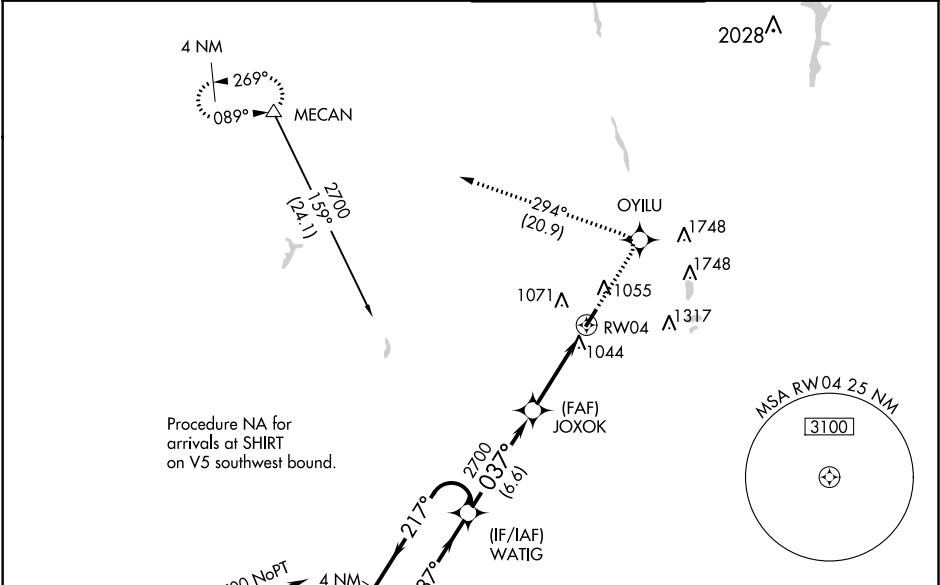

4 NM Holding Pattern

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 25).

3000

OYILU

MECAN

tr 294°

*LNAV only.

WATIG

JOXOK

2700

037°

037°

217°

6000

2700

GP 3.00°

TCH 39

6.6 NM

4 NM

1.4

RW04

* 1.4 NM to RW04

CATEGORY	A	B	C	D
LPV DA	1163-½ 259 (300-½)			
LNAV/VNAV DA	1325-1 421 (500-1)			
LNAV MDA	1360-½ 456 (500-½)	1360-7/8 456 (500-7/8)	1360-1 456 (500-1)	1360-1 456 (500-1)
CIRCLING	1360-1 456 (500-1)	1380-1 476 (500-1)	1380-1½ 476 (500-1½)	1500-2 596 (600-2)

ELEV 904

TDZE 904

TWR 972

REIL Rwy 22

MIRL Rwy 4-22