

APP CRS 328°	Rwy Idg 5256 TDZE 933 Apt Elev 942
------------------------	---


RNAV (GPS) RWY 33
GARNER FIELD (UVA)

T
A


When local altimeter setting not received, use South Texas Rgnl at Hondo altimeter setting and increase all MDA 100 feet and increase LNAV Cat C and D and Circling Cat C visibility ¼ mile. DME/DME RNP-0.3 NA.

MISSED APPROACH:
Climbing right turn to 3500
direct BUXQU WP and hold.

AWOS-3 124.175	HOUSTON CENTER 134.95 269.4	UNICOM 122.8 (CTAF) 0
--------------------------	---------------------------------------	---------------------------------

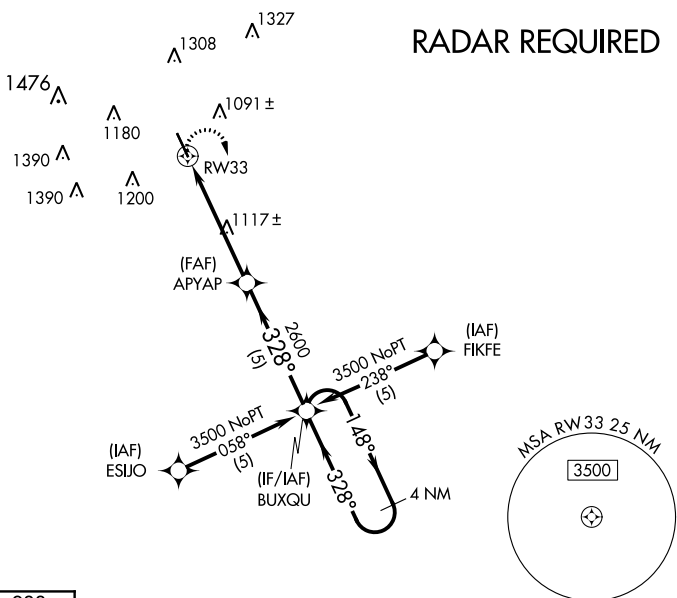

ELEV	942		TDZE	933
------	-----	--	------	-----

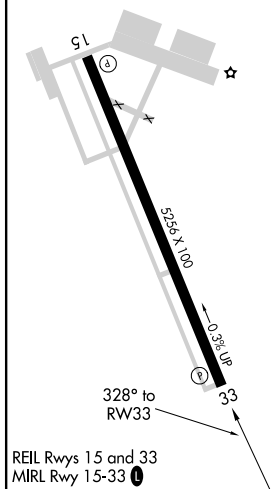

3500 BUXQU

VGSI and descent angle not coincident
(VGSI Angle 3.00/TCH 35).

4 NM
Holding Pattern

CATEGORY	A	B	C	D
GLS DA	NA			
LNAV/ VNAV DA	NA			
LNAV MDA	1380-1 447 (500-1)		1380-1 $\frac{1}{4}$ 447 (500-1 $\frac{1}{4}$)	1380-1 $\frac{1}{2}$ 447 (500-1 $\frac{1}{2}$)
CIRCLING	1380-1 438 (500-1)	1460-1 518 (600-1)	1460-1 $\frac{1}{2}$ 518 (600-1 $\frac{1}{2}$)	1500-2 558 (600-2)