


LOC/DME I-PQL 110.1 Chan 38	APP CRS 168°	Rwy Idg 6500 TDZE 17 Apt Elev 17	ILS or LOC RWY 17 TRENT LOTT INTL (PQL)
---	------------------------	---	--

When local altimeter setting not received, use Mobile Rgnl altimeter setting and increase DA to 292 feet; increase all MDA 80 feet and S-LOC 17 visibility Cat B ¼ mile, and Cats C and D ½ mile, increase Circling visibility Cats B and C ¼ mile. OTIME Fix Minimums, increase S-LOC 17 visibility Cats C and D ½ mile and Circling Cats C and D ½ mile. For inop MALSRS when using Mobile Rgnl altimeter setting increase S-ILS all Cats visibility to ¾ mile.

MALSRS

MISSED APPROACH: Climb to 900 then climbing left turn to 2000 direct SJI VORTAC and hold.

ATIS 135.175	MOBILE APP CON★ 121.0 307.1	TRENT LOTT TOWER★ 118.575 (CTAF) 0	GND CON 121.725	CLNC DEL 121.725	UNICOM 122.8
------------------------	---------------------------------------	--	---------------------------	----------------------------	------------------------

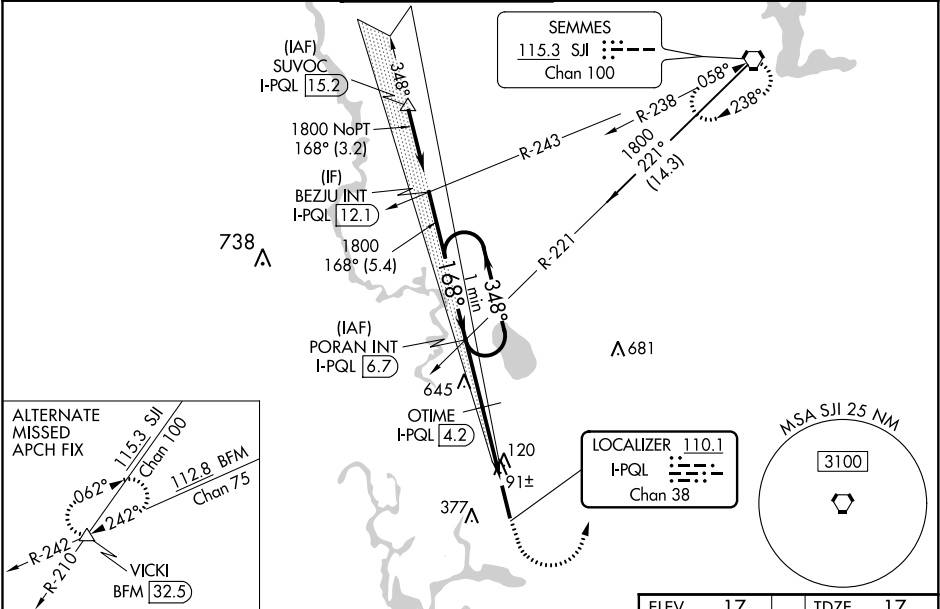

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 54).				ELEV 17		TDZE 17	
One Minute Holding Pattern				*LOC only.		#980 when using Mobile Rgnl altimeter setting.	