


TACAN BKF Chan 33	APCH CRS 328°	Rwy ldg 11,006 TDZE 5663 Arpt Elev 5663	JAL-538 [USAF]	BUCKLEY AFB (KBKF)
-----------------------------	-------------------------	--------------------------------------------------------------------	----------------	--------------------

▽ * When ALS inop, increase CAT CDE vis to 1¾ miles. ** Circling NA East of Rwy 14-32.	ALSF-1 	MISSED APPROACH: Climbing right turn to 8200 and intercept BKF TACAN R-148 direct BEKEE and hold or as directed by ATC.
--------------------------------------------------------------------------------------------------	------------	-------------------------------------------------------------------------------------------------------------------------

ATIS ★ 119.675 259.3	DENVER APP CON 128.45 251.075	BUCKLEY TOWER ★ 121.0 291.675	GND CON 121.6 275.8	CLNC DEL 121.6 275.8
--------------------------------	-----------------------------------------	-----------------------------------------	-------------------------------	--------------------------------

Missed approach requires use of RNAV or ATC RADAR monitoring.

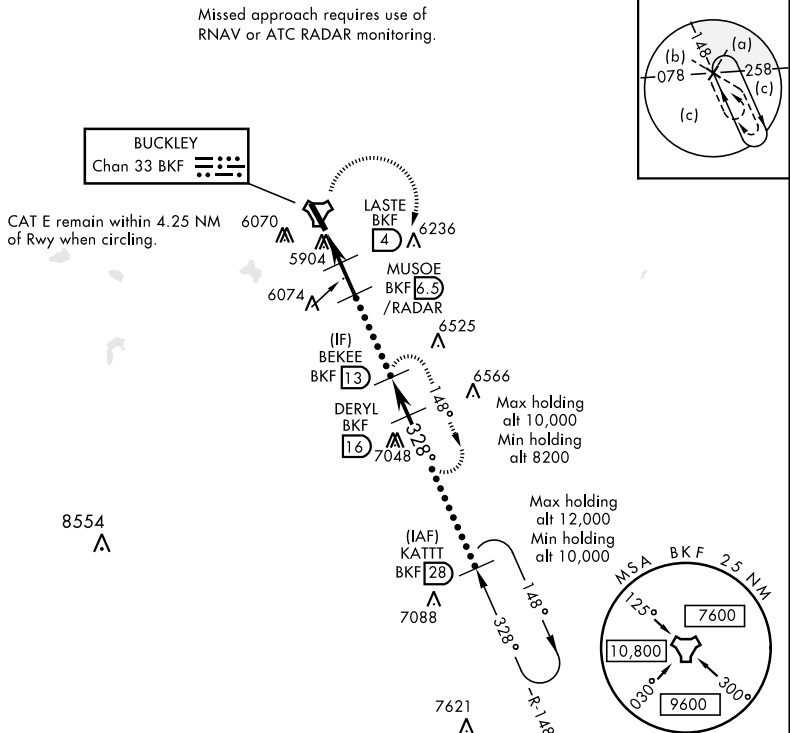

EMERG SAFE ALT 100 NM 16,500

8200 BKF R-148	BEKEE BKF (13)	ELEV 5663	TDZE 5663
TACAN	CENAR (1.7)	LASTE (4)	MUSOE (6.5) /RADAR
BEKEE (13)	DERYL (16)	KATT (28)	10,000
5 NM	2.3 NM	2.5 NM	3.02°
CATEGORY	C	D	E
S-32 *	6280-1¾	617 (700-1¾)	
CIRCLING **	6360-2 697 (700-2)	6400-2¼ 737 (800-2¼)	6420-2¾ 757 (800-2¾)

AURORA, COLORADO

39°42'N-104°45'W

BUCKLEY AFB (KBKF)

Amdt 3 27APR17

HI-TACAN RWY 32