

LOC I-MSS	APP CRS	Rwy Idg	5601
108.7	045°	TDZE	205
		Apt Elev	222

ILS or LOC RWY 5

MASSENA INTL-RICHARDS FIELD (MSS)

ADF required. ADF and RADAR required for procedure entry.


▼

▲ NA

Circling Rwy 9, 23, 27 NA at night. When local altimeter setting not received, use Potsdam altimeter setting and increase all DAs 73 feet and all MDAs 80 feet; increase S-ILS all Cats visibility 1/8 SM, S-LOC Cat C visibility 1/8 SM and increase Circling Cat C visibility 1/8 SM, and Cat D 1/4 SM.

MISSED APPROACH:
Climb to 1200 then climbing left turn to 2300 direct MISSE LOM and hold.

ASOS 128.075	BOSTON CENTER 135.25 377.1	UNICOM 123.0 (CTAF) 0
-----------------	-------------------------------	--------------------------

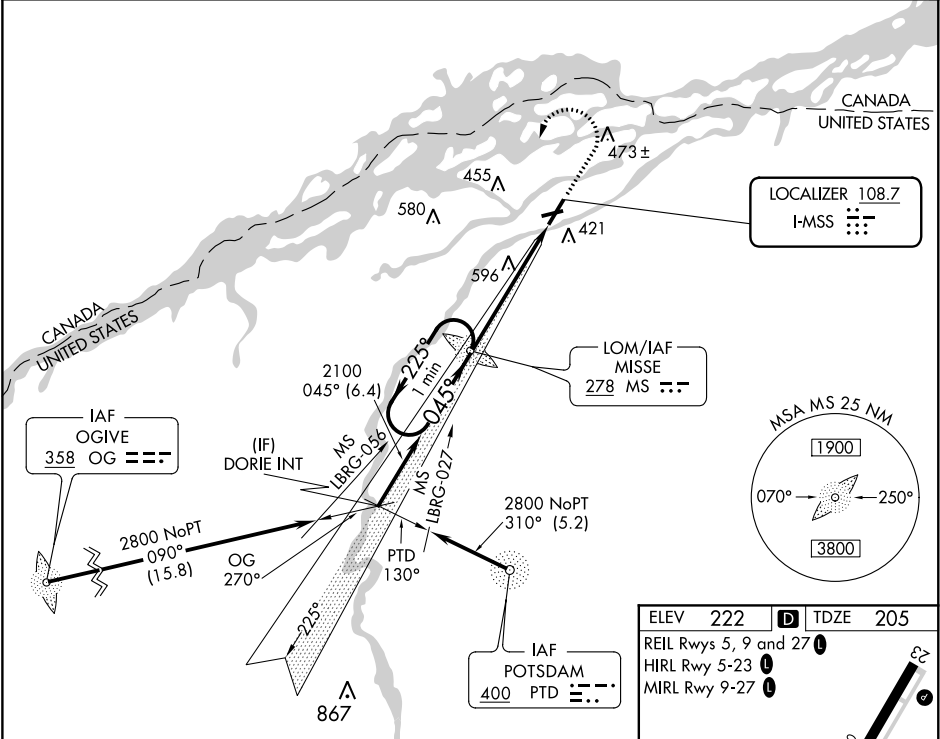

One Minute Holding Pattern

2300

225°

045°

GS 3.00°

TCH 54

2100

045°

5.4 NM

MISSE LOM

1994

1200

2300

MS

VGSI and ILS glideslope not coincident (VGSI Angle 3.00/TCH 58).

CATEGORY	A	B	C	D
S-ILS 5		455-3/4	250 (300-3/4)	
S-LOC 5	800-1	595 (600-1)	800-13/4	595 (600-13/4)
CIRCLING	800-1	578 (600-1)	800-13/4	900-2 1/4

ELEV 222 D TDZE 205

REIL Rwy 5, 9 and 27 0

HIRL Rwy 5-23 0

MIRL Rwy 9-27 0

4000 X 100

5601 X 100

0.3% UP

045° 5.4 NM from FAF

FAF to MAP 5.4 NM

Knots	60	90	120	150	180
Min:Sec	5:24	3:36	2:42	2:10	1:48