
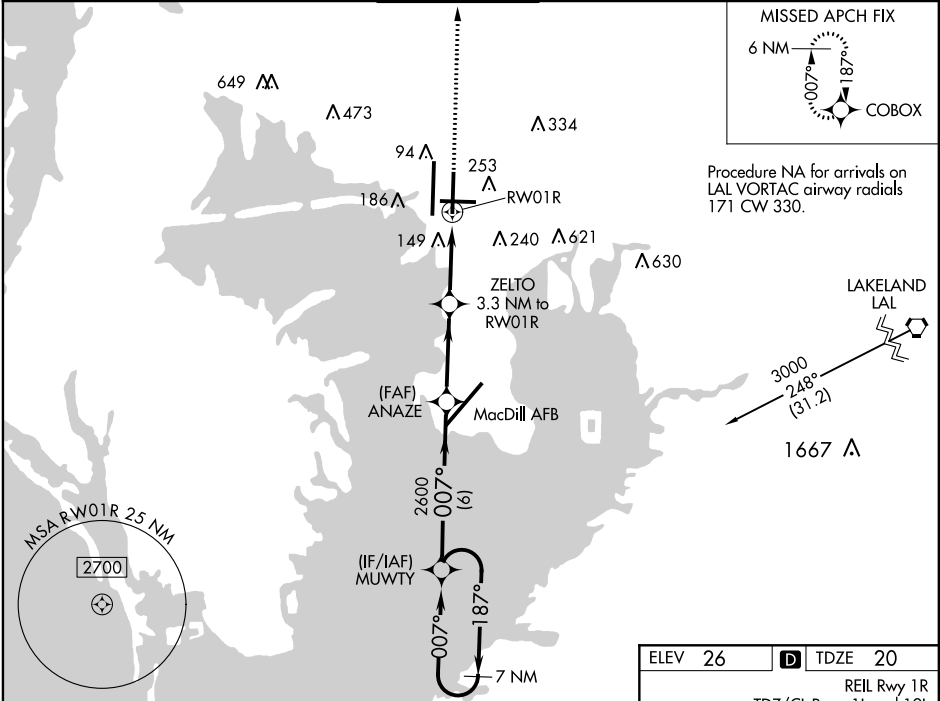


WAAS CH 87105 W01B	APP CRS 007°	Rwy Idg 8300 TDZE 20 Apt Elev 26
---------------------------------	------------------------	-------------------------------------------------------------

RNAV (GPS) RWY 1R
TAMPA INTL (TPA)

	For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 0°C (32°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. Simultaneous approach authorized with Rwy 1L. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations.	MISSED APPROACH: Climb to 2000 direct COBOX and hold.
---------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------

ARR 126.45	D-ATIS 128.475	DEP 118.5 307.175	TAMPA APP CON 119.5 269.4	TAMPA TOWER 121.7 269.4	GND CON 133.6	CLNC DEL 133.6	CPDLC
----------------------	--------------------------	-----------------------------	-------------------------------------	-----------------------------------	-------------------------	--------------------------	-------



VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 71).					
7 NM Holding Pattern					
2600 ← 187° 007° → 2600					
GP 3.50° TCH 55					
MUWTY ANAZE 2600 ZELTO 3.3 NM to RW01R *1.1 NM to RW01R RW01R					
*1300					
6 NM 3.5 NM 2.2 NM 1.1 NM					
CATEGORY	A	B	C	D	E
LPV DA	290-7/8	270 (300-7/8)		NA	
LNAV/VNAV DA	491-13/8	471 (500-13/8)		NA	
LNAV MDA	440-1	420 (500-1)	440-1 1/4	420 (500-1 1/4)	
CIRCLING	560-1	534 (600-1)	680-1 3/4 654 (700-1 3/4)	980-3	954 (1000-3)

